


fill the MOTION of air

User's Guide




sconiTM
moving up & down

(A)

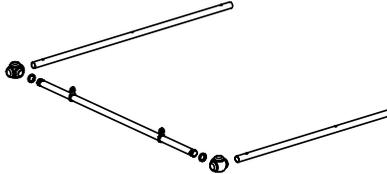


First Step you see the Photo there are 2 same pipe & one pipe is different then take 2 big Casting pc's with its Check Nut & Put this 3 pipe in its same like photo.

(B)

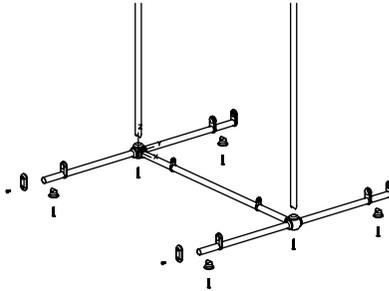


In this Photo Put 2 other pipe with its L & Key from down & then Fix the other casting pc's all the side & then put the Leg with its L & Key all 4 side & Fix all L&Key very Tight.

(C)

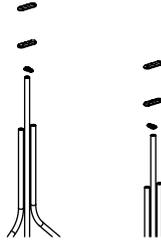


In this Photo now put 4 Bend Pipe & then Put the Casting Pc's Shown as Photo, but see that when u fix this 4 Pipe with its casting pc's this 4 pipe see the Through & very Tight L&Key also.


(D)

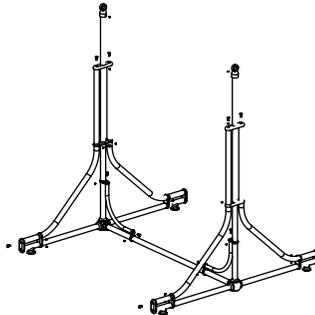

(E)

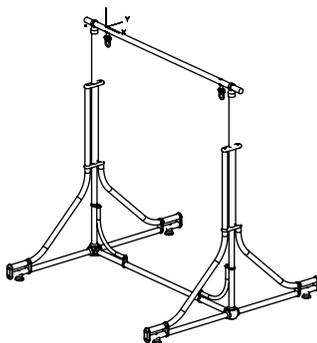

(F)

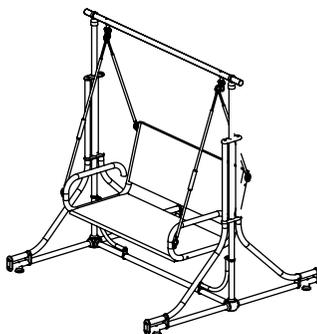

1 0 0 % K N O C K - D O W N s y s t e m



Design Pattern
No. 233777

sconi™
moving up & down



Manufacturing By :



CRYSTAL
HANDRAIL™
WORLD

Rajkot.(Gujarat) India

E-mail : info@handrailworld.co.in

Web : www.handrailworld.co.in